

S/No. TL-2007-064-009

## 【Vehicle Details】

Chassis No: GRS180-0066116 Model: DBA-GRS180 Engine Model: 4GR  
 Maker: TOYOTA 1st Registration Year: 2007/06 Engine No: 0344826  
 Model Name: \_\_\_\_\_ Manufacture Year: 2007 Weight: 1570 Kg  
 Engine Capacity: 2490 cc Type of Vehicle: Sedan FF Axis Weight: 840 Kg  
 Body Color: Black Mileage(Paper): 137,100 Km FR Axis Weight: \_\_\_\_\_ Kg  
 Fuel Type: GASOLINE Odometer: 157,825 km RF Axis Weight: \_\_\_\_\_ Kg  
 RR Axis Weight: 730 Kg

## 【Inspection Details】

Location: Osaka Inspector: Toru Fujiwara

## 【Test Drive】

Abnormal at Acceleration ☒ Pass/Fail  
 Abnormal at Brake Test ☒ Pass/Fail

## 【Side Slip】

IN / OUT 2.3 mm ☒ Pass/Fail

## 【Speedometer】

Difference 0.6 km/h ☒ Pass/Fail  
 Run-out 0 km/h ☒ Pass/Fail

## 【Exhaust】

CO 0.00 % ☒ Pass/Fail  
 HC 0 ppm ☒ Pass/Fail  
 DS \_\_\_\_\_ %/m-1 ☒ Pass/Fail

## 【Exhaust proximity noise】

Average 61 dB(A) ☒ Pass/Fail

## 【Radiation Dose】

☒ Pass/Fail

## 【Headlights】

Luminance R 291 x100cd ☒ Pass/Fail  
 L 241 x100cd ☒ Pass/Fail  
 Attachment R 65 cm ☒ Pass/Fail  
 (Height) L 65 cm ☒ Pass/Fail  
 Optical Axis R 0 cm ☒ Pass/Fail  
 (Under) L 0 cm ☒ Pass/Fail  
 Optical Axis R 0 cm ☒ Pass/Fail  
 (RL) L 0 cm ☒ Pass/Fail

## 【Brake System】

FL	FR	ML	MR	RL	RR	PL	PR	Sum main brake (Weight+55kg)	Sum parking brake (Weight+55kg)	Sum R wheel brake (axis weight)	Pull: Front (axis Weight+55kg)	Pull: Rear (axis Weight)	Sum Main brake=	Sum parking brake=	Sum R wheel brake=	Diff b/w R&L axis=	Pass/Fail	
297	309			245	269	209	217	1625	1625	730	895	730	1120	426	514	12	24	✓
								x0.5= 813	x0.2= 325	x0.1= 73	x0.08= 72	x0.08= 59						

## 【Engine】

Engine ☒ Result  
 Fan belt ☒  
 Battery ☒  
 Master Cylinder ☒  
 Caburetor ☒  
 Fuel Pipes ☒  
 Injection Pump ☒  
 Wiring Harness ☒  
 Generator ☒  
 Cooling Syatem ☒  
 Manifolds ☒  
 Lubrication System ☒  
 CFC ☒ R-134a

## 【Equipment】

Tool ☒ Result  
 Jack ☒

## 【Underbody】

Wheel Bearing ☒ Result  
 Springs ☒  
 Shock Absorbers ☒  
 Suspension Fixing ☒  
 Torque Rod ☒  
 Gear Box ☒  
 Steering Rod/Arm ☒  
 Wheel Cylinder ☒  
 Brake Rod/Cable ☒  
 Breake Hose/Pipe ☒  
 Front axle ☒  
 Drive Shaft ☒  
 Propeller Shaft ☒  
 Axle Housing ☒  
 Differential ☒  
 Tyre Size ☒  
 Tyre Condition ☒  
 Tyre ETC ☒

## 【Accessory】

A/C ☒ AT/MT: AT  
 Audio ☒  
 Navigation ☒  
 Alloy Wheel ☒

## 【Interior】

Steering Wheel ☒ Result  
 Power Steering ☒  
 Horn ☒  
 Gauges ☒  
 Climate Control ☒  
 Door ☒  
 Windows ☒  
 Wipers ☒  
 Mirrors (Back & Sides) ☒  
 Shift Lever ☒  
 Safety Belts ☒  
 Brake Pedal ☒  
 Brake Booster ☒  
 Clutch Pedal ☒  
 Clutch Function ☒

## 【Lights】



Head lamp ☒ Result  
 Indicator ☒  
 Rear ☒  
 Brake ☒  
 ETC ☒

## 【ETC】

Exhaust System ☒ Result  
 Air Suspension ☒  
 Air Brake ☒  
 Fuel Tank ☒

## 【Damage】

Exterior ☒ Result  
 Interior ☒  
 Underbody ☒

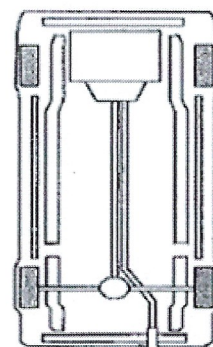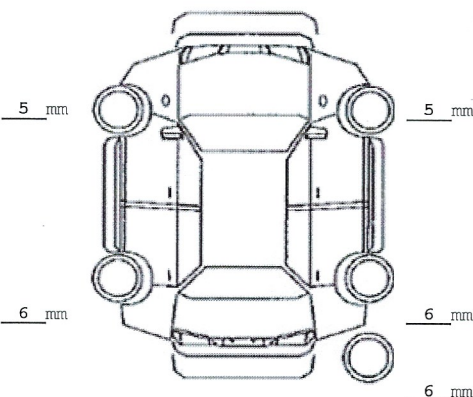

F=Repair A=Scratch U=Dent R=Rust CR=Crack D=Damage

## 【Result】

Pass ☒  
 Fail ☐

Inspector Signature Toru Fujiwara  
 Inspection Date 2020-07-27

## 【Reinspection】

Pass ☐  
 Fail ☐

Inspector Signature \_\_\_\_\_  
 Inspection Date2 \_\_\_\_\_

## 【Fail Parts】